


Mods to get over bogging problem –early EVOs with Keihin Carb

The first EVOs sometimes bogged going down hill or when hopping around. Originally it was thought that fuel was not flowing freely to the main jet when bouncing around, and the extra holes were drilled in the drain plug. The fix was mainly that the plastic overflow/vent pipe was causing siphoning. If this was route upwards somewhere above the carb the fault disappeared. In 2010 the pipe had a small vee cut in it to allow venting and the problem disappeared.

Drill holes in carburettor drain plug to allow full flow to jets (Griffo mod).

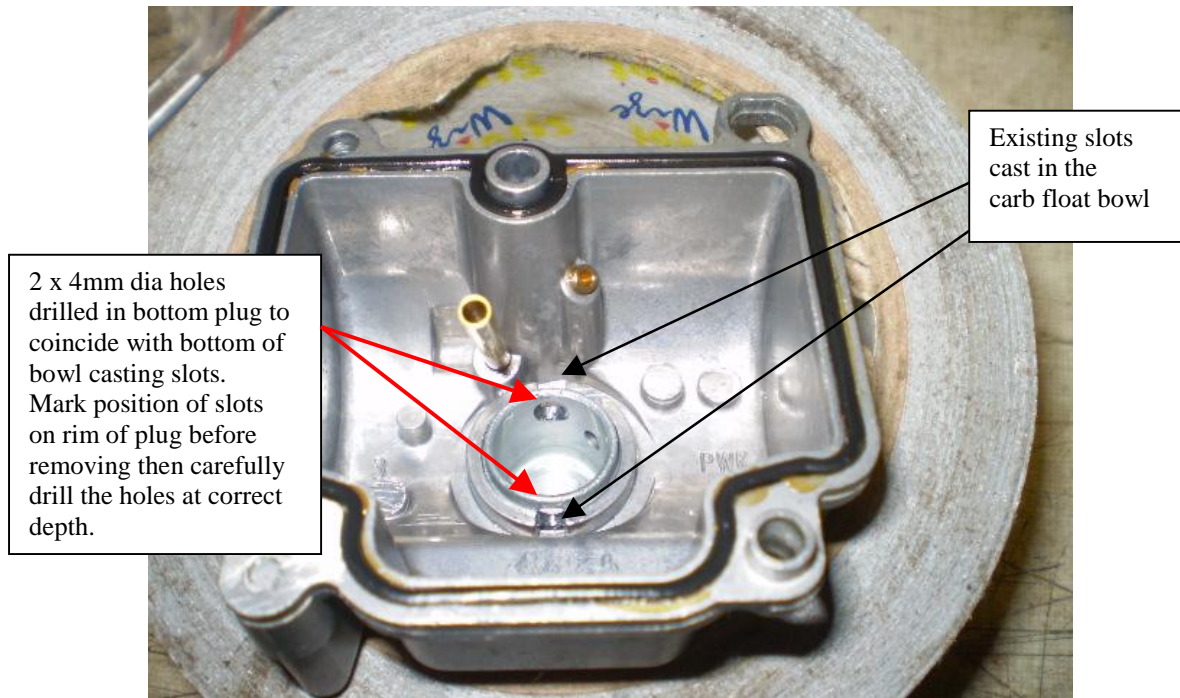

Make a mark like a saw cut on the outside of the float bowl and bottom plug to give correct alignment after plug removable.

